

Manhole Inspection Summary

Manhole # S39G__105MH

Printed On: 8/24/2009

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **39G** Node: **105** Status: **New Manhole (Not in GIS)** Insp Date: **7/14/08 12:00 AM**

Incomplete Comments

Crew: **sac**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **866 E Lombard St**

Cross Street: **S High St**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Concrete** ☐ Parged Height: **4** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Concrete** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Concrete** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps Count: **9** Missing: **0** ☒ **Corroded**

Surcharge ☒ **Evidence Of Surcharge** Depth: **9.** (ft.) ☐ Active Surcharge Present

07

Manhole Inspection Summary

Manhole # S39G__105MH


Printed On: 8/24/2009

Page 2 of 3

Location View



Top View

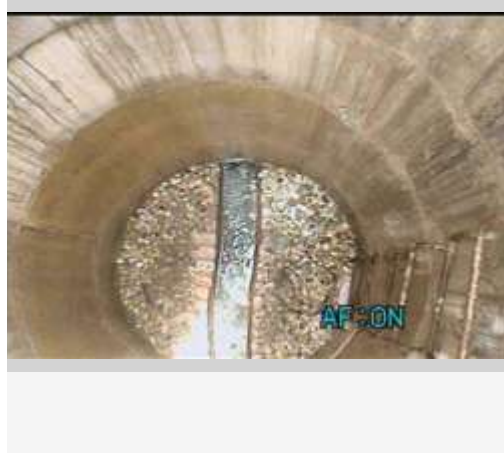

Defect 1



channel debris

Defect 4



bench debris

Defect 3



evidence of surcharge

Defect 2



infiltration staining in corbel and barrel,
corroded steps

Manhole Inspection Summary

Manhole # S39G__105MH

Printed On: 8/24/2009

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: PVC ☐ Pipe Lined

Invert Depth: 11.40 (ft.) Flow Characteristics: Slow

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: None Pipe Seal Cond: Unknown

Drop: None

Connects To: Manhole

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: PVC ☐ Pipe Lined

Invert Depth: 11.30 (ft.) Flow Characteristics: Slow

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: None Pipe Seal Cond: Unknown

Drop: None

Connects To: Manhole

☐ Possible Illicit Connection